

MP2623, MP2624, MP2625, MP2626 REAR COIL SPRING SPACER INSTALLATION INSTRUCTIONS

REMOVAL PROCEDURE:

- 1. Raise and support the vehicle securely with jack-stands.
- 2. Install a rear axle support such as a floor jack under the differential.
- 3. Remove the shock absorber lower mounting bolts.
- 4. Remove sway bar link bolts.
- 5. Remove the bolts and plates that hold down the coil springs to the control arms.
- 6. Slowly lower the rear axle with the jack.


NOTE: Use care when handling the coil springs in order to avoid chipping or scratching the coating. Damage to the coating will result in premature failure of the coil springs.

7. Remove the rear coil springs.

INSTALLATION PROCEDURE:

- 1. Install rear coil spring spacer onto the axle mounting plate/perch.
- 2. Install one rear coil spring on top of the spacer.
- 3. Insert included bolt & flat washer with factory hold-down bracket into the spring and onto the lift spacer.
- 4. Add lock washer and nut and tighten down to manufacturers specs.
- 5. Repeat 1-4 for second spring. **NOTE:** Reuse upper rubber coil insulator between car & spring when putting springs back in place.
- 6. Slowly raise the rear axle and make sure the top of the springs mount back into place.
- 7. Install the shock absorber lower mounting bolts and tighten bolts to manufacturers torque specs.
- 8. Reconnect sway bar link bolts.
- 9. Remove rear axle support.
- 10. Slowly lower the vehicle.
- 11. Jounce rear of vehicle and take for a test drive.

NOTE: 2" (MP2626) tall spacer sets may need rear extended shocks or shock extenders after installation (not included).

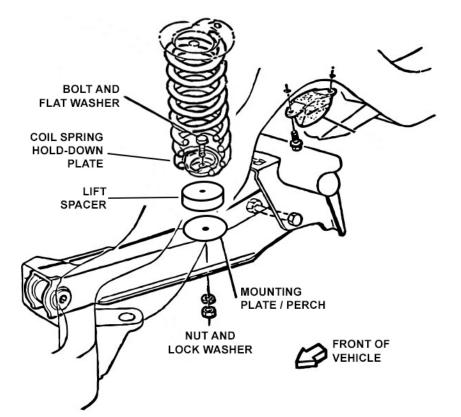

SPACER PART NUMBERS & SIZES

MP2623 - 0.5" (gives 1/2" of lift) MP2624 - 1.0" (gives 1" of lift) MP2625 - 1.5" (gives 1-1/2 of lift) MP2626 - 2.0" (gives 2" of lift)

| APPLICATIONS |
|--------------------|
| CHEVROLET |
| 1965-1970 Bel Air |
| 1965-1970 Biscayne |
| 1966-1970 Caprice |
| 1965-1970 Impala |

WARRANTY: Spacers are warranted from manufacturers defects for the life of the vehicle. Warranty does not cover damage to spacers due to improper installation or use. Refunds for warranty issues will consist of original order cost only and do not cover any labor costs or any other costs that were incurred.

DISCLAIMER: McBay Performance, Inc. is not responsible or liable for any damage to vehicle, property or persons when product is being installed, removed or in use.